

## Release Note IT-G500(WEH6.5 Pro) Service Pack

### ◆ Released software

IT-G500 Service Pack for Windows Embedded Handheld 6.5.3 Professional

### ◆ Version

Ver 1.01

### ◆ Released files name

	File name	Ver	Remarks
IT-G500	ServicePackITG500WMPRE.101.CAB	1.01	New
IT-G500	DeleteCab.ini	1.01	New
IT-G500	Setup.exe	2.06	

### ◆ Target model & OS Build ID

IT-G500-G15E (OS Build ID 653201 & 653205)

IT-G500-GC16E (OS Build ID 653201 & 653205)

IT-G500-GC26E (OS Build ID 653201 & 653205)

IT-G500-G15E-TR (OS Build ID 653205)

IT-G500-GC16E-TR (OS Build ID 653205)

IT-G500-GC26E-TR (OS Build ID 653205)

### ◆ Contents

This is modified Service Pack Program for IT-G500(WEH6.5Pro).

### ◆ Detail

●The contents of ServicePack1.01 are included.

1.Improved : This may take a while, decoding reversed color bar code.

2.Improved : This may take a while, connecting WLAN immediately after disconnecting Bluetooth.

3. Improved: This may take a while, switching AP in the roaming.

4.Fixed : In rare case, when you copy some files to IT-G500 via WMDC, the terminal is disconnected.

5.Fixed : Code128 delimiter (GS) is not output by a laser scanner.

6.Fixed : Issue of connecting an authentication PAP.

7.Fixed : When you turn off / on the IT-G500 while opening the laser scanner, scanner operation returns to the default.

8.Fixed : Issue that can not operate PDA when you call turning LED off / on from some functions.

9.Fixed : When you disable WPC addon symbology, the terminal can decode it.

10.Fixed : When you edit and save a file encoding Shift-JIS on TextEditor, an encoding is UTF-8

## BOM.

- 11.Fixed : Issue of flicker in screen.
- 12.Fixed : When you unlock PUK on WAN Setting, the terminal reboot.
- 13.Improved : Add a registry for setting of recording volume.
- 14.Fixed : In rare case, when FLINK/FLCE transfer files to PC from HT, an error occurs.

●The contents of ServicePack1.00 are included.

- 1.Fixed; EAN(UPC) Composite is unreadable when you enable the reading of the EAN Addon.
- 2.Fixed: Issue the buzzer to stop the camera shooting in buzzer.
- 3.Fixed: When WLAN communication is out of range and unit is not operated, memory leak has been corrected if backlight is turned off.
- 4.Fixed: In rare case, transfer error occurs when you transfer file size approx 10MB or above via USB.
- 5.Fixed: In the wireless LAN power ON state,WLAN connection LED will remain Off When you do suspend / resume.
- 6.Fixed: In the Control Panel> Imager Setting> Option, and select the appropriate code , "Request Addon" If you check, it is a specification that reads only code with Addon, it would be read even if there is no Addon.
- 7.Fixed: It may result in an error when you run the IMGInit from application Windows immediately after starting.
- 8.Fixed: When displaying the channel setting screen, channel setting state is not displayed correctly without displaying the wireless standard screen.
- 9.Fixed: Issue of rarely locked up when suspend/resume is repeatedly performed.
- 10.Improved: To improve the readability under the scorching sunlight, it has been adjusted the brightness control of backlight even at higher temperature.
- 11.Fixed: In rare case, using power key to perform power off process may causing locked up due to the incomplete power off process.
- 12.Fixed: If you have made the connection settings in the MS standard WLAN configuration tool (Wi-Fi), and suspend / resume the setting is deleted, it is no longer able to connect to the AP.
- 13.Fixed: WLAN communication in a weak electric field can not be for a while. ( several tens of seconds )
- 14.Improved: The reading improvement of obfuscation CODE128 / JAN
- 15.Fixed: Issue that can not be connected to the network when you use the IP information of the cradle.
- 16.Fixed: After pressing the power off key , issue that moment displayed with when you press the power key until off is processed.
- 17.Fixed: Issue of audio cuts during a voice input , such as recording.

◆ **How to get patch file**

- **Download from distributor support pages** (Available from 1<sup>st</sup> February 2016)  
Access following url for download

[https://dealer.casio.jp/system\\_en/pa/PADealer/](https://dealer.casio.jp/system_en/pa/PADealer/)

## Software Download

All the information in this bulletin is subject to change without prior notice to the distributors